

NOTES:

North orientation for the Original Plat is based on the plot in Vol. 7780 Pg. 24. North orientation for the Replat is based on rotating the northeast line to grid north, NAD83(CORS96) Texas State Plane, Central Zone by utilizing GPS methods.

All easement information shown on this plat was derived from the final replat of Blinn College Subdivision recorded in Volume 7780, Page 24 of the Official Records of Brazos County. Strong Surveying, LLC did not engage in any additional easement research.



All Building Setbacks will be according to the City of Bryan Land and Site Development Ordinance.

City of Bryan Utilities are shown based on the City of Bryan GIS mapping system. Strong Surveying did not locate utilities on the ground.

LEROY

- 1/2" Iron Rod Found
- 1/2" Iron Rod with Cap Found
- 1/2" Iron Rod with Cap Set
- Fire Hydrant
- Sewer Manhole

LINE	BEARING	DISTANCE
L1	S 76°15'48" W	34.28'
L2	S 42°52'59" W	61.15'
L3	S 37°18'43" W	57.50'
L4	N 58°36'38" W	54.84'
L5	S 06°19'50" W	13.67'
L6	N 42°47'11" W	6.11'
L7	N 76°53'26" W	43.10'
L8	S 115°32'0" W	11.45'

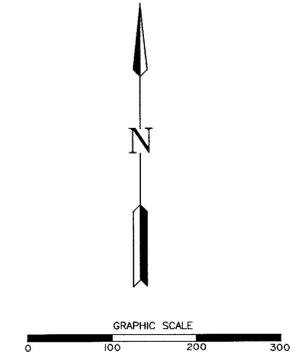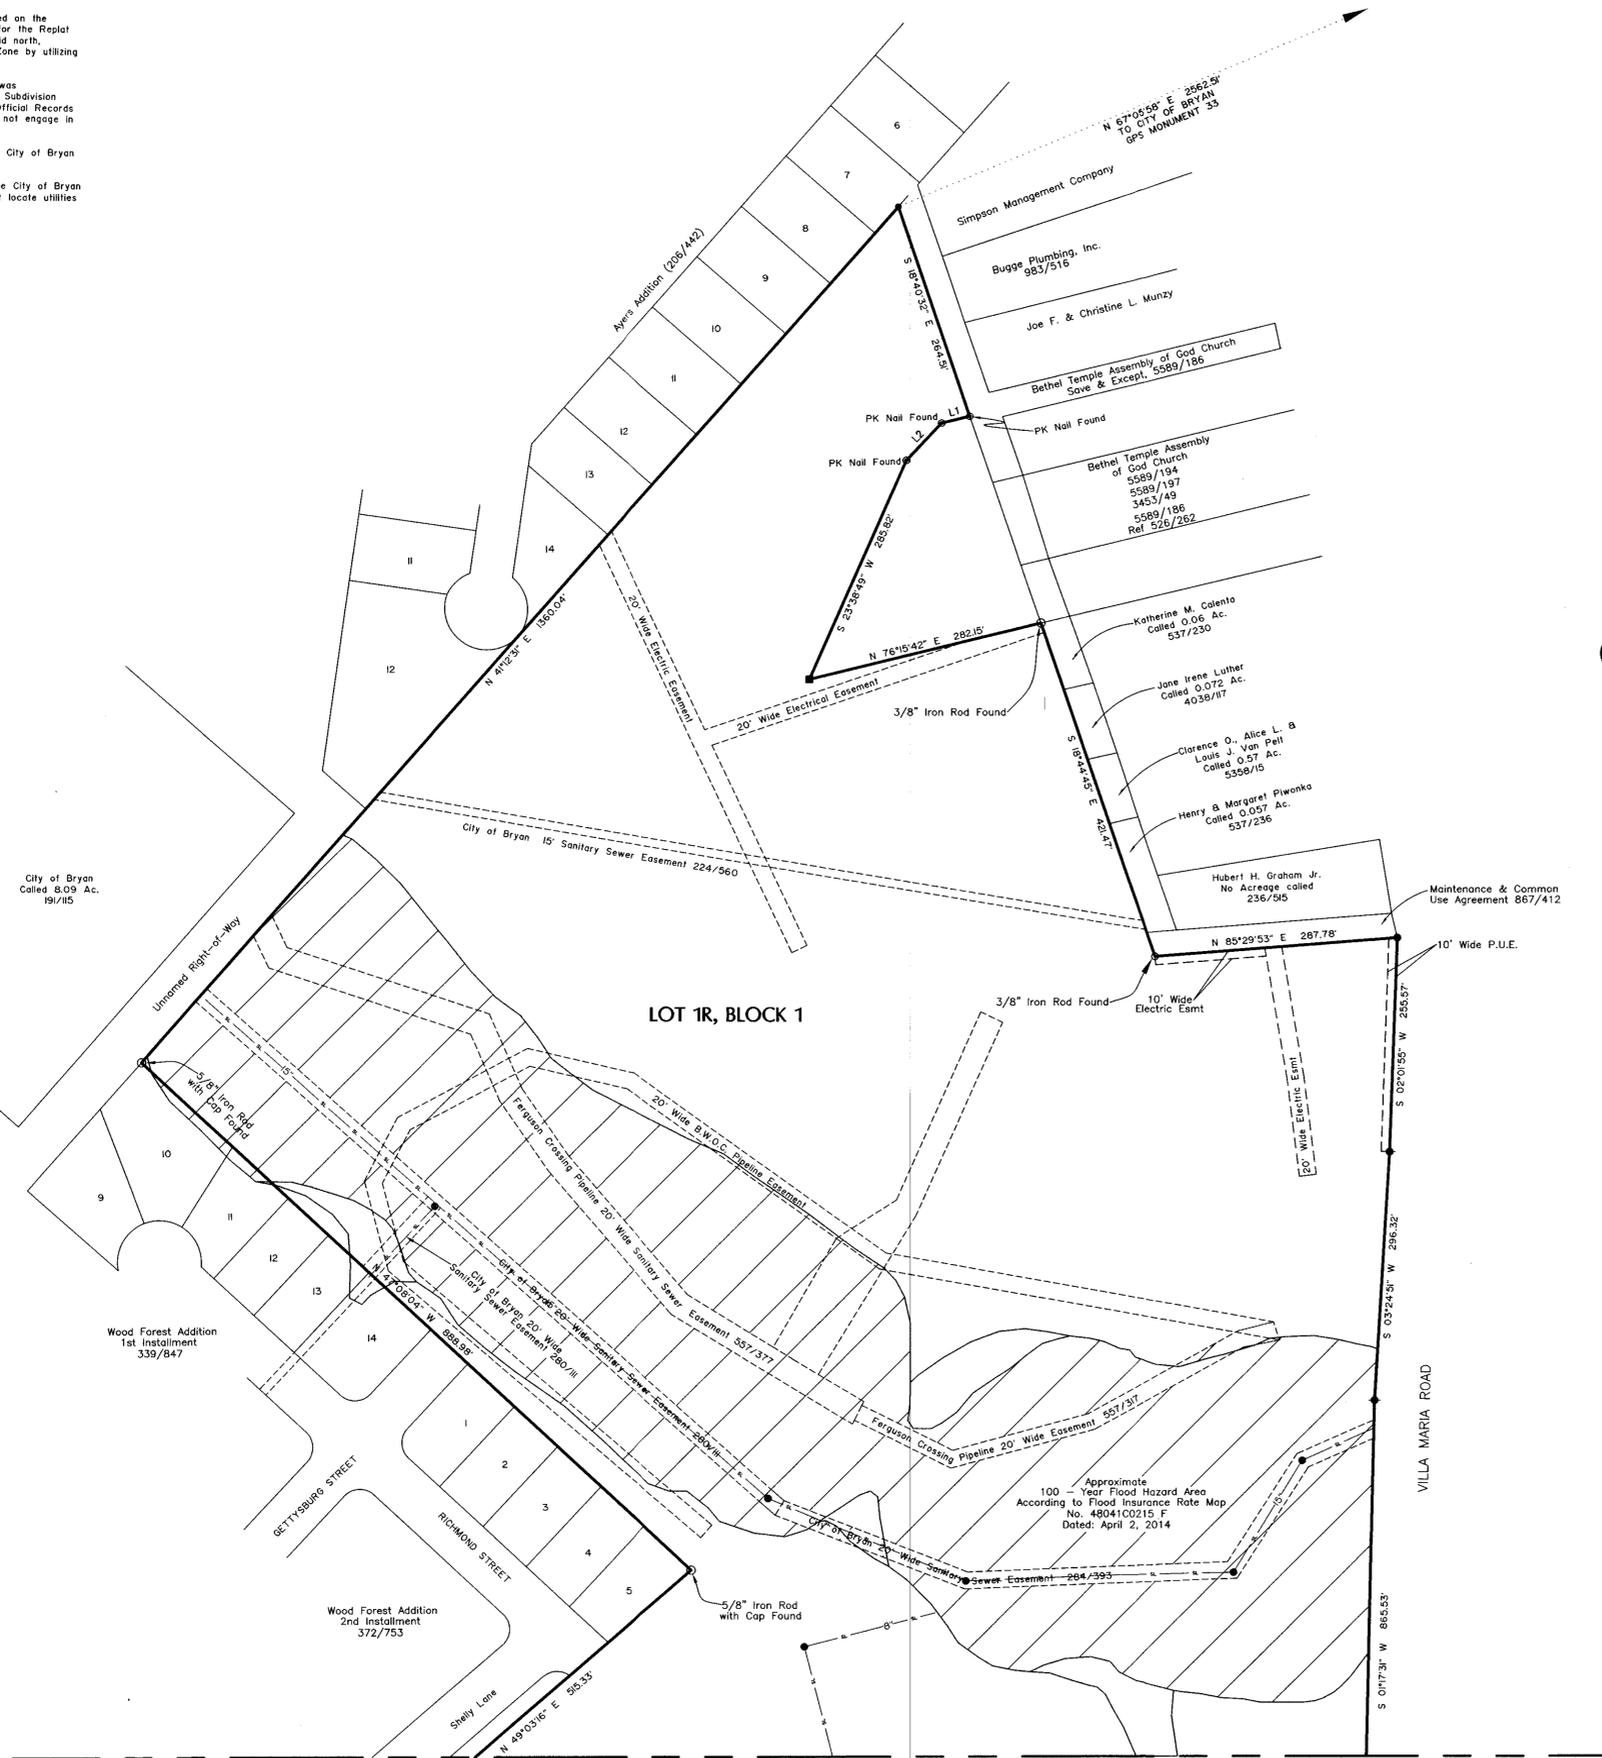

ORIGINAL PLAT

Site Address: 2423 Blinn Blvd, Bryan Texas, 77802

REPLAT
OF
BLINN COLLEGE SUBDIVISION
LOT 1R-R, BLOCK 1
82.96 ACRES
 BEING ALL OF LOT 1R, BLOCK 1
 BLINN COLLEGE SUBDIVISION
 VOLUME 11999, PAGE 231
 BEING ALL OF LOT 1, BLOCK 1
 AND
 THE BLINN COLLEGE
 1.25 ACRES TRACT
 VOLUME 12155, PAGE 217
 JOHN AUSTIN SURVEY, A-2
 BRYAN, BRAZOS COUNTY, TEXAS
 SCALE 1"=100' NOVEMBER 25, 2014
 SHEET 1 OF 4

Development
 NOV 25 2014
 RECEIVED

OWNER: Washington County Junior College District
 902 College Ave.
 Brenham, Texas 77833-4049
 Phone No. 979-830-4054
 Fax 979-830-4155

STRONG SURVEYING
 1722 Broadmoor, Suite 105
 Bryan, Texas 77802
 Phone: (979) 776-9836
 Fax: (979) 731-0096
 Firm No. 10093500 email: curtis@strongsurveying.com

MATCHLINE SHEET 2

NOTES:

North orientation is based on rotating the northeast line to grid north, NAD83(CORS96) Texas State Plane, Central Zone by utilizing GPS methods.

All easement information shown on this plat was derived from the final replat of Blinn College Subdivision recorded in Volume 7780, Page 24 of the Official Records of Brazos County. Strong Surveying, LLC did not engage in any additional easement research.


All Building Setbacks will be according to the City of Bryan Land and Site Development Ordinance.

City of Bryan Utilities are shown based on the City of Bryan GIS mapping system. Strong Surveying did not locate utilities on the ground.

LEGEND:

- 1/2" Iron Rod Found
- 1/2" Iron Rod with Cap Found
- 1/2" Iron Rod with Cap Set
- Fire Hydrant
- Sewer Manhole

MATCHLINE SHEET 1

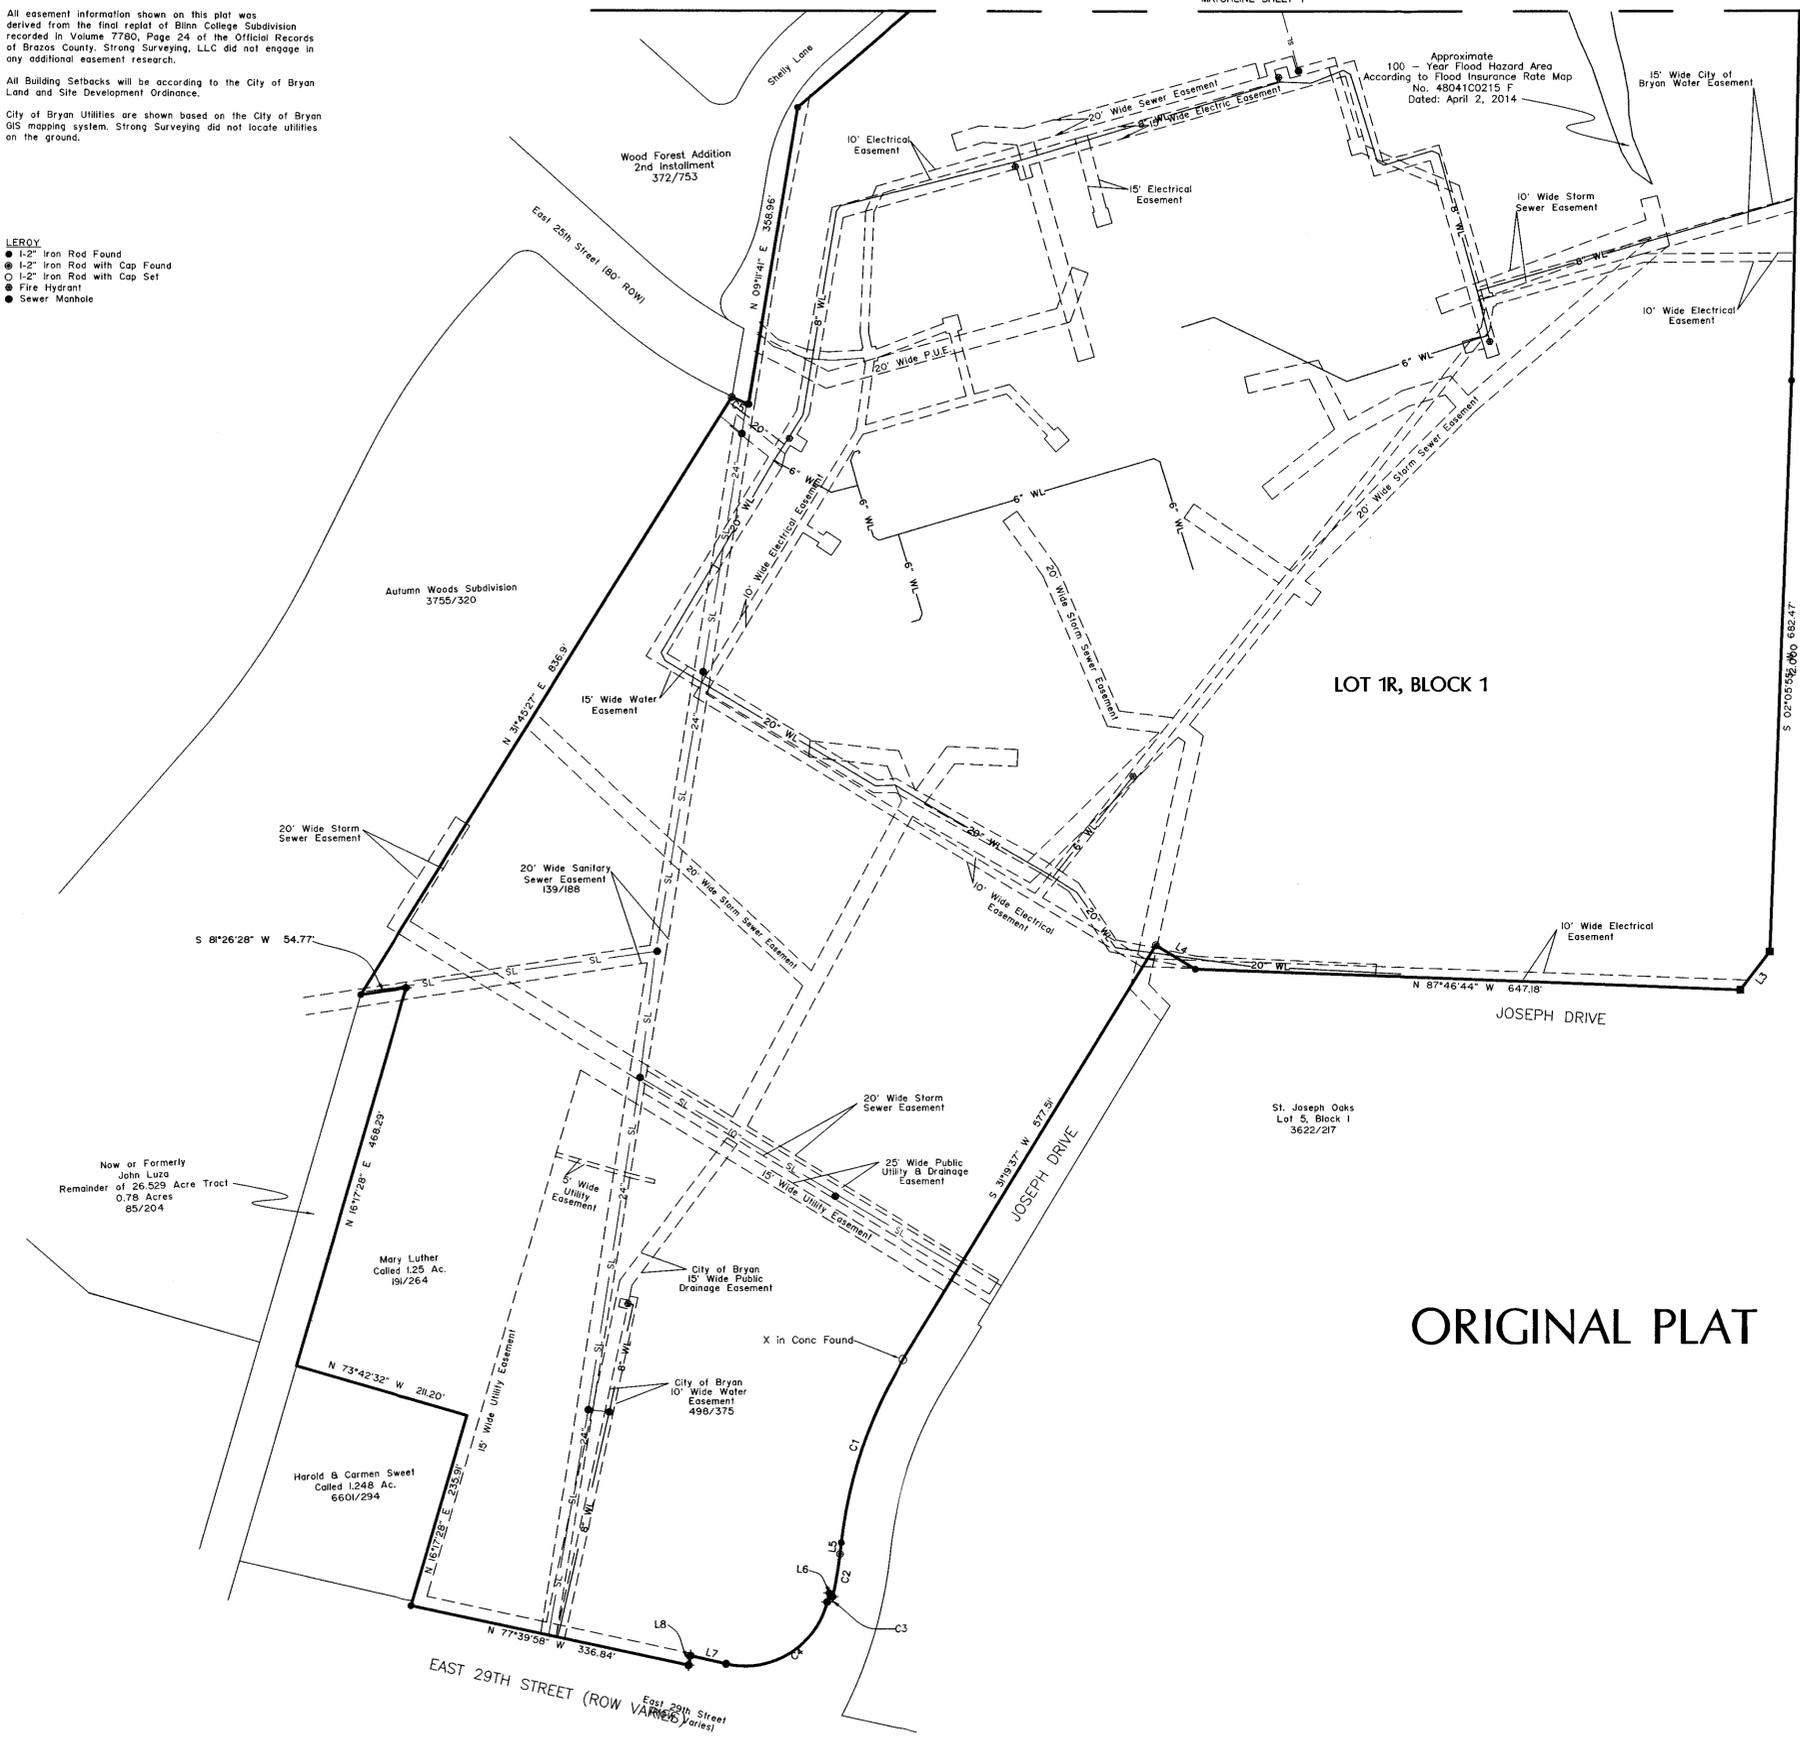

LINE	BEARING	DISTANCE
L1	S 76°15'48" W	34.28'
L2	S 42°52'59" W	61.15'
L3	S 37°18'43" W	57.50'
L4	N 58°36'38" W	54.84'
L5	S 06°19'50" W	13.67'
L6	N 42°47'11" W	6.11'
L7	N 76°53'26" W	43.10'
L8	S 11°53'20" W	11.45'

CURVE TABLE					
CURVE	DELTA	RADIUS	LENGTH	CHORD BEARING	CHORD LENGTH
C1	24°59'47"	529.99'	231.23'	S 18°43'43" W	223.39'
C2	06°18'33"	470.01'	51.76'	S 09°29'05" W	51.73'
C3	09°34'14"	66.59'	11.12'	S 12°54'13" W	11.11'
C4	89°32'10"	39.8'	155.97'	S 58°27'57" W	140.58'
C5	02°07'2"	590.00'	21.96'	S 64°21'19" E	21.86'

Site Address: 2423 Blinn Blvd, Bryan Texas, 77802

REPLAT OF BLINN COLLEGE SUBDIVISION LOT 1R-R, BLOCK 1 82.96 ACRES

BEING ALL OF LOT 1R, BLOCK 1
BLINN COLLEGE SUBDIVISION
VOLUME 11999, PAGE 231
BEING ALL OF LOT 1, BLOCK 1
AND

THE BLINN COLLEGE
1.25 ACRES TRACT
VOLUME 12155, PAGE 217

JOHN AUSTIN SURVEY, A-2
BRYAN, BRAZOS COUNTY, TEXAS
SCALE 1"=100' NOVEMBER 25, 2014
SHEET 2 OF 4

ORIGINAL PLAT

OWNER: Washington County Junior College District
902 College Ave.
Brenham, Texas 77833-4049
Phone No. 979-830-4054
Fax 979-830-4155

STRONG SURVEYING
1722 Broadmoor, Suite 105
Bryan, Texas 77802
Phone: (979) 776-9836
Fax: (979) 731-0096
Firm No. 10093500 email: curtis@strongsurveying.com

NOTES:

North orientation for the Original Plat is based on the plat in Vol. 7780 Pg. 24. North orientation for the Replat is based on rotating the northeast line to grid north. NAD83/CORS961 Texas State Plane, Central Zone by utilizing GPS methods.

All easement information shown on this plat was derived from the final replat of Blinn College Subdivision recorded in Volume 7780, Page 24 of the Official Records of Brazos County, Strong Surveying, LLC did not engage in any additional easement research.

All Building Setbacks will be according to the City of Bryan Land and Site Development Ordinance.

City of Bryan Utilities are shown based on the City of Bryan GIS mapping system. Strong Surveying did not locate utilities on the ground.

LEGEND



- 1/2" Iron Rod Found
- 1/2" Iron Rod with Cap Found
- 1/2" Iron Rod with Cap Set
- Fire Hydrant
- Sewer Manhole

LINE	BEARING	DISTANCE
L1	S 76°15'48" W	34.28'
L2	S 42°52'59" W	61.15'
L3	S 37°18'43" W	57.50'
L4	N 53°38'38" W	54.84'
L5	S 06°19'50" W	13.67'
L6	N 42°47'11" W	6.11'
L7	N 76°53'26" W	43.10'
L8	S 11°53'20" W	11.45'

FIELD NOTES 82.96 ACRES
LOT 1R-R, BLOCK 1
BLINN COLLEGE SUBDIVISION

All that certain lot, tract or parcel of land being 82.96 acres situated in the JOHN AUSTIN SURVEY, Abstract No. 2, Brazos County, Texas and being all or a part of the following described tracts; it being all of Lot 1R, Block 1, Blinn College Subdivision as shown in REPLAT recorded in Volume 11999, Page 231 and 21 being a part of that certain Called 1.25 acre tract as described in deed from Raymond Luther et al to The Junior College District of Washington County, Texas or/s Blinn College of record in Volume 1255, Page 217, all being Official Records of Brazos County, Texas, said 82.96 acre tract being more particularly described by metes and bounds as follows:

BEGINNING at a 1/2" Iron Rod found for the most northerly corner, said corner being the most northerly corner of said Blinn College Subdivision;
THENCE along the easterly line of said Blinn Subdivision the following calls:
S 18° 40' 32" E, a distance of 264.51 feet to a PK nail found for angle point;
S 76° 15' 48" W, a distance of 34.28 feet to a PK nail found for angle point;
S 42° 52' 59" W, a distance of 61.15 feet to a PK nail found for angle point; and,
S 23° 38' 49" W, a distance of 285.82 feet to a 1/2" Iron Rod found for angle point;
THENCE N 76° 15' 42" E, along a north line of said Blinn College Subdivision a distance of 282.15 feet to a 3/8" Iron Rod found for an exterior corner;
THENCE S 18° 44' 45" E, along an east line of said Blinn College Subdivision a distance of 421.47 feet to a 3/8" Iron Rod found for an exterior corner, said corner being the northwest corner of said Lovett Subdivision;
THENCE N 85° 29' 53" E, along the north line of said Lovett Subdivision a distance of 287.78 feet to a 1/2" Iron Rod with Cap found in the west right-of-way line of Villa Maria Road for an exterior corner, said corner being the northeast corner of said Lovett Subdivision;
THENCE along the west right-of-way line of said Villa Maria Road with Cap set at the southwest corner of said Lovett Subdivision for angle point;
S 2° 01' 55" W, a distance of 255.57 feet to a 1/2" Iron Rod with Cap set at the southwest corner of said Lovett Subdivision for angle point;
S 3° 24' 09" W, a distance of 236.32 feet to a point in creek for angle point;
S 1° 17' 31" W, a distance of 865.53 feet to a 1/2" Iron Rod found for angle point; and,
S 2° 05' 55" W, a distance of 682.47 feet to a 1/2" Iron Rod with Cap found for angle point at the transition of the intersection of said Villa Maria Road west right-of-way line and the Joseph Drive north right-of-way line;
THENCE S 37° 19' 43" W, a distance of 57.50 feet to a 1/2" Iron Rod with Cap in the north right-of-way line of said Joseph Drive;
THENCE along the north right-of-way line of said Joseph Drive the following calls:
N 87° 46' 44" W, a distance of 647.18 feet to a 1/2" Iron Rod found for angle point; and,
N 58° 36' 38" W, a distance of 54.84 feet to a PK nail found in the northwesterly right-of-way line of said Joseph Drive for an interior corner;
THENCE S 31° 19' 37" W, along the northwesterly right-of-way line of said Joseph Drive a distance of 577.51 feet to an "X" in concrete found for the beginning of a curve;
THENCE with said northwesterly right-of-way line around a curve in a counterclockwise direction having a delta angle of 24° 59' 47", an arc distance of 529.99 feet, and a chord of S 18° 49' 43" W, a distance of 229.39 feet to a 1/2" Iron Rod found for the point of tangency of said curve;
THENCE S 6° 19' 50" W, continuing along the northwesterly right-of-way line of said Joseph Drive a distance of 13.67 feet to a 1/2" Iron Rod with Cap found for the beginning of a curve;
THENCE continuing along the northwesterly right-of-way line of said Joseph Drive around a curve in a clockwise direction having a delta angle of 06° 18' 33", an arc distance of 51.76 feet, a radius of 470.01 feet, and a chord of S 9° 29' 05" W, a distance of 51.73 feet to a 1/2" Iron Rod with Cap set for the end of curve;
THENCE N 42° 47' 11" W, a distance of 6.11 feet to a 1/2" Iron Rod with Cap set for the beginning of a non-tangent curve;
THENCE around a curve in a clockwise direction having a delta angle of 09° 24' 14", an arc distance of 11.12 feet, a radius of 66.59 feet, and a chord of S 12° 51' 13" W, a distance of 11.11 feet to a 1/2" Iron Rod with Cap set at the beginning of a non-tangent curve;
THENCE around a curve in a clockwise direction having a delta angle of 89° 32' 10", an arc distance of 155.97 feet, a radius of 99.81 feet, and a chord of S 58° 27' 57" W, a distance of 140.88 feet to a 1/2" Iron Rod found in the northerly right-of-way line of East 29th Street for the end of said curve;
THENCE N 76° 53' 26" W, along the northerly right-of-way line of said East 29th Street a distance of 431.0 feet to a 1/2" Iron Rod with Cap set for an interior corner and angle point in said right-of-way line;
THENCE S 11° 53' 20" W, a distance of 11.45 feet to a 1/2" Iron Rod with Cap set in the northerly right-of-way line of said East 29th Street for angle point;
THENCE N 77° 39' 58" W, continuing along the northerly right-of-way line of said East 29th Street a distance of 336.84 feet to a 1/2" Iron Rod with Cap set for the most southerly southwest corner, said corner being the most southerly southwest corner of said Blinn College Subdivision;
THENCE N 16° 17' 28" E, along a west line of said Blinn College Subdivision a distance of 235.91 feet to a 1/2" Iron Rod with Cap set at a southeast corner of said Called 1.25 acre tract for an exterior corner;
THENCE N 73° 42' 32" W, along the south line of said Called 1.25 acre tract a distance of 281.20 feet to a 1/2" Iron Rod with Cap set for a southwest corner of said Called 1.25 acre tract for an exterior corner;
THENCE N 16° 17' 28" E, along a west line of said Called 1.49 acre tract a distance of 468.29 feet to a 1/2" Iron Rod with Cap set at an interior corner of said Called 1.49 acre tract for an interior corner;
THENCE S 81° 26' 28" W, a distance of 54.77 feet to a 1/2" Iron Rod with Cap found for a point in the west line of said Blinn College Subdivision and the east line of the Autumn Woods Subdivision as described in Volume 3755, Page 320 for an exterior corner;
THENCE N 31° 45' 27" E, with the common line between said Blinn College Subdivision and said Autumn Woods Subdivision a distance of 836.90 feet to a 1/2" Iron Rod with Cap set in the southwesterly right-of-way line of East 29th Street for an exterior corner;
THENCE around a curve in a counterclockwise direction having a delta angle of 02° 07' 21", an arc distance of 21.86 feet, a radius of 590.00 feet, and a chord of S 66° 21' 19" E, a distance of 21.86 feet to a point for the most southerly corner of Wood Forest Addition 2nd installment for an exterior corner;
THENCE N 9° 11' 41" E, along the common line between said Blinn College Subdivision and the east line of said Wood Forest Addition a distance of 358.96 feet to a 1/2" Iron Rod found for angle point;
THENCE N 49° 03' 16" E, continuing along the common line of said Blinn College Subdivision and the southeasterly line of said Wood Forest Addition a distance of 515.33 feet to a 5/8" Iron Rod with Cap found for the most easterly corner of said Wood Forest Addition for an interior corner;
THENCE N 47° 08' 04" W, along the southwest line of said Blinn College Subdivision and the northeast line of said Wood Forest Addition 2nd and 1st installment respectively a distance of 888.98 feet to a 5/8" Iron Rod with Cap found for the most northerly corner of said Wood Forest Addition 1st installment for a westerly corner;
THENCE N 41° 12' 31" E, along the northwest line of said Blinn College Subdivision a distance of 1360.04 feet to the PLACE OF BEGINNING AND CONTAINING AN AREA OF 82.96 ACRES OF LAND MORE OR LESS.

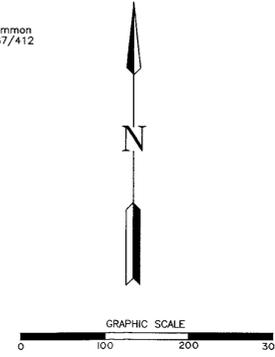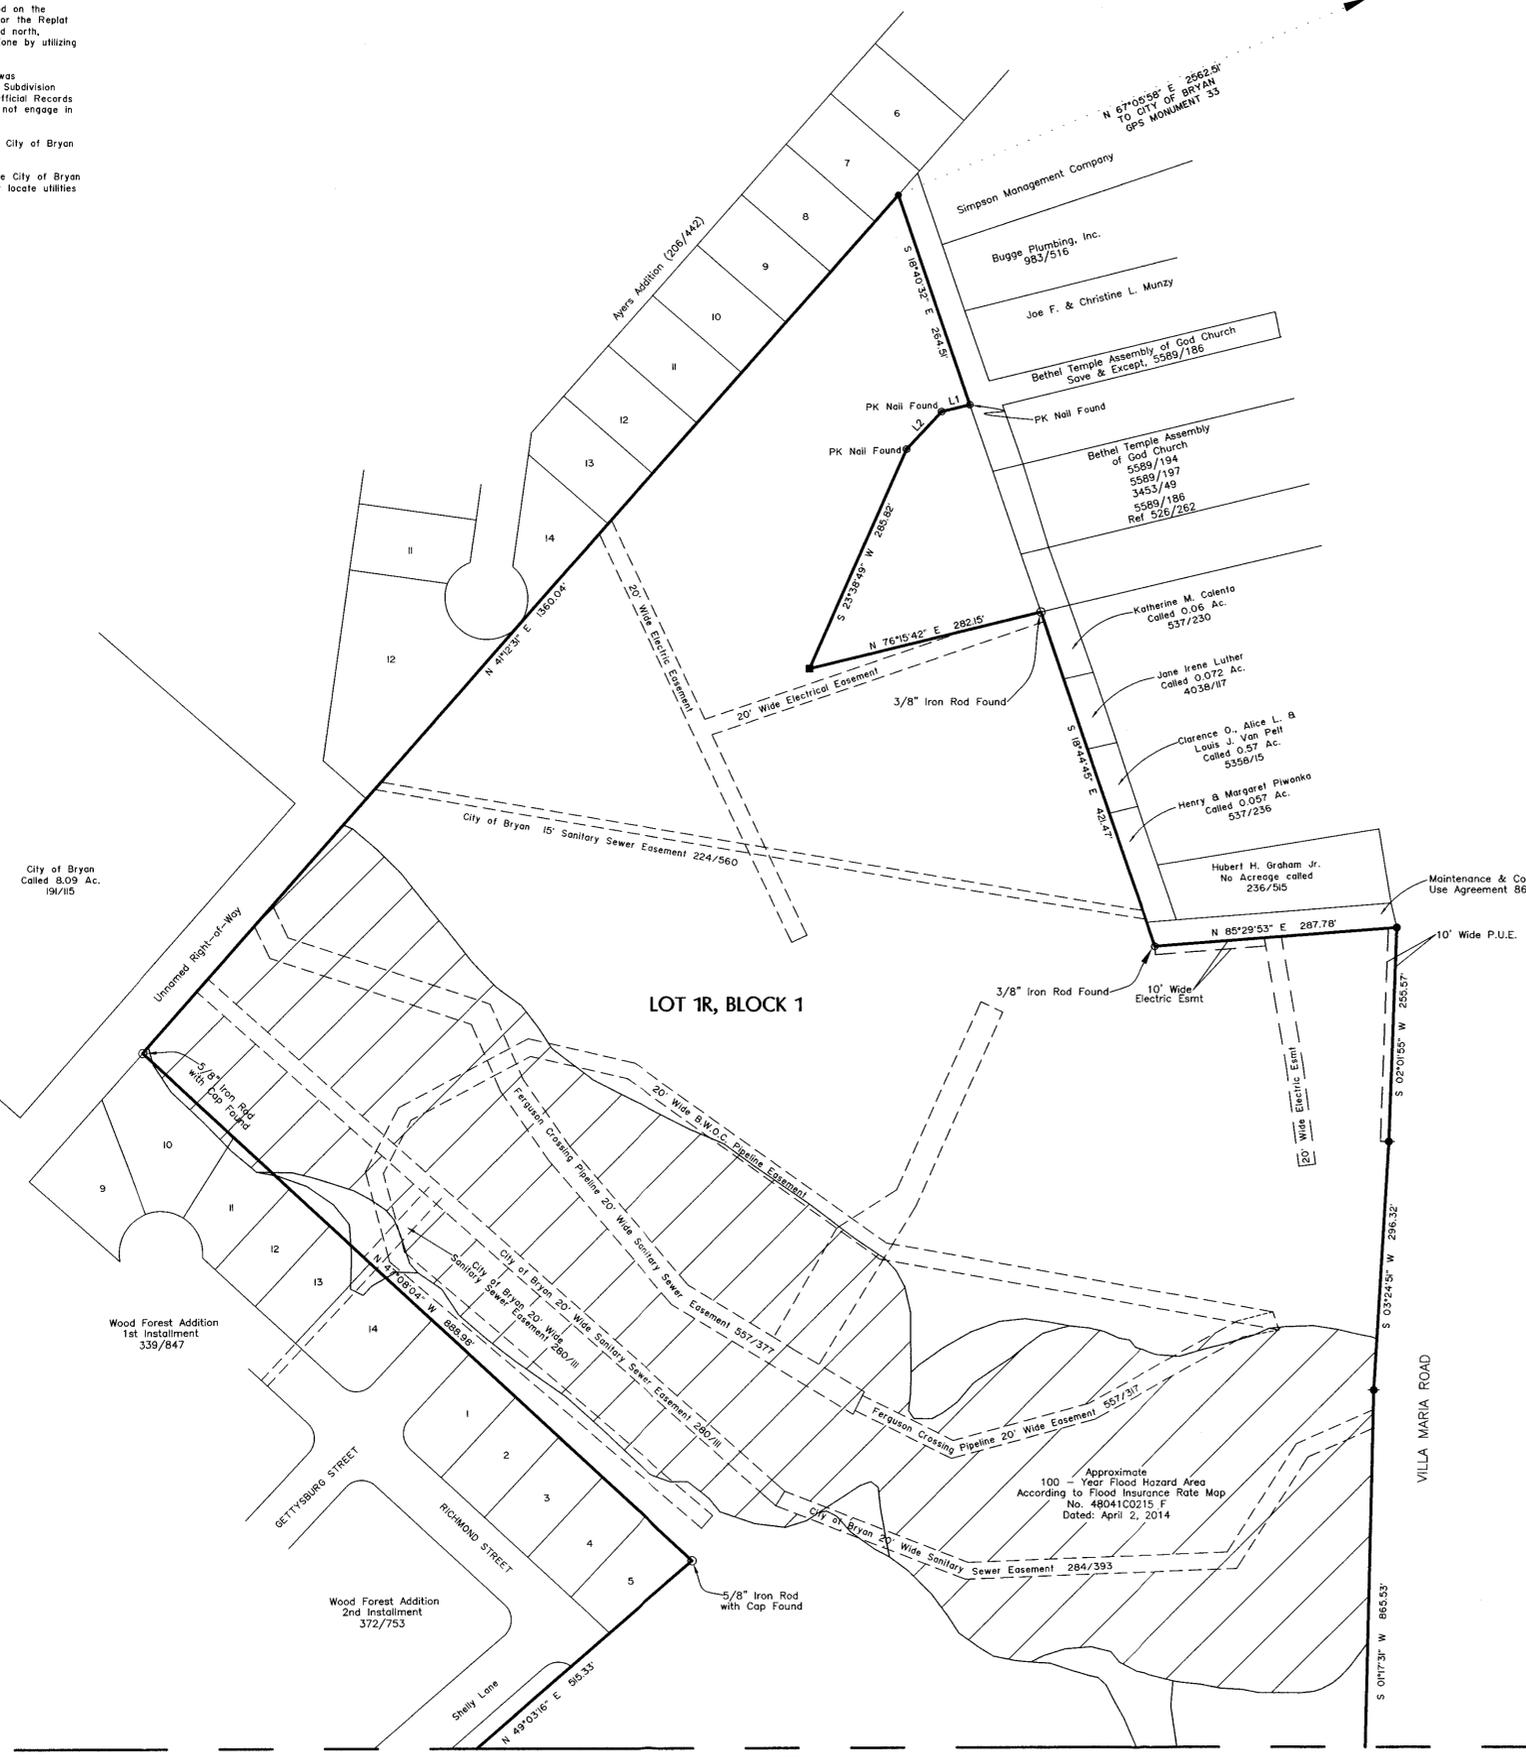

Site Address: 2423 Blinn Blvd, Bryan Texas, 77802

REPLAT OF BLINN COLLEGE SUBDIVISION LOT 1R-R, BLOCK 1 82.96 ACRES

BEING ALL OF LOT 1R, BLOCK 1
BLINN COLLEGE SUBDIVISION
VOLUME 11999, PAGE 231
BEING ALL OF LOT 1, BLOCK 1
AND
THE BLINN COLLEGE
1.25 ACRES TRACT
VOLUME 12155, PAGE 217

REPLAT

JOHN AUSTIN SURVEY, A-2
BRYAN, BRAZOS COUNTY, TEXAS
SCALE 1"=100' NOVEMBER 25, 2014
SHEET 3 OF 4


OWNER: Washington County Junior College District
902 College Ave.
Brenham, Texas 77833-4049
Phone No. 979-830-4054
Fax 979-830-4155

STRONG SURVEYING
1722 Broadmoor, Suite 105
Bryan, Texas 77802
Phone: (979) 776-9836
Fax: (979) 731-0096
Email: curtis@strongsurveying.com


MATCHLINE SHEET 4

NOTES:
 North orientation is based on rotating the northeast line to grid north, NAD83(CORS96) Texas State Plane, Central Zone by utilizing GPS methods.
 All easement information shown on this plat was derived from the final replat of Blinn College Subdivision recorded in Volume 7780, Page 24 of the Official Records of Brazos County, Strong Surveying, LLC did not engage in any additional easement research.
 All Building Setbacks will be according to the City of Bryan Land and Site Development Ordinance.
 City of Bryan Utilities are shown based on the City of Bryan GIS mapping system. Strong Surveying did not locate utilities on the ground.

LEROY
 ● 1-2" Iron Rod Found
 ○ 1-2" Iron Rod with Cap Found
 ○ 1-2" Iron Rod with Cap Set
 ● Fire Hydrant
 ● Sewer Manhole

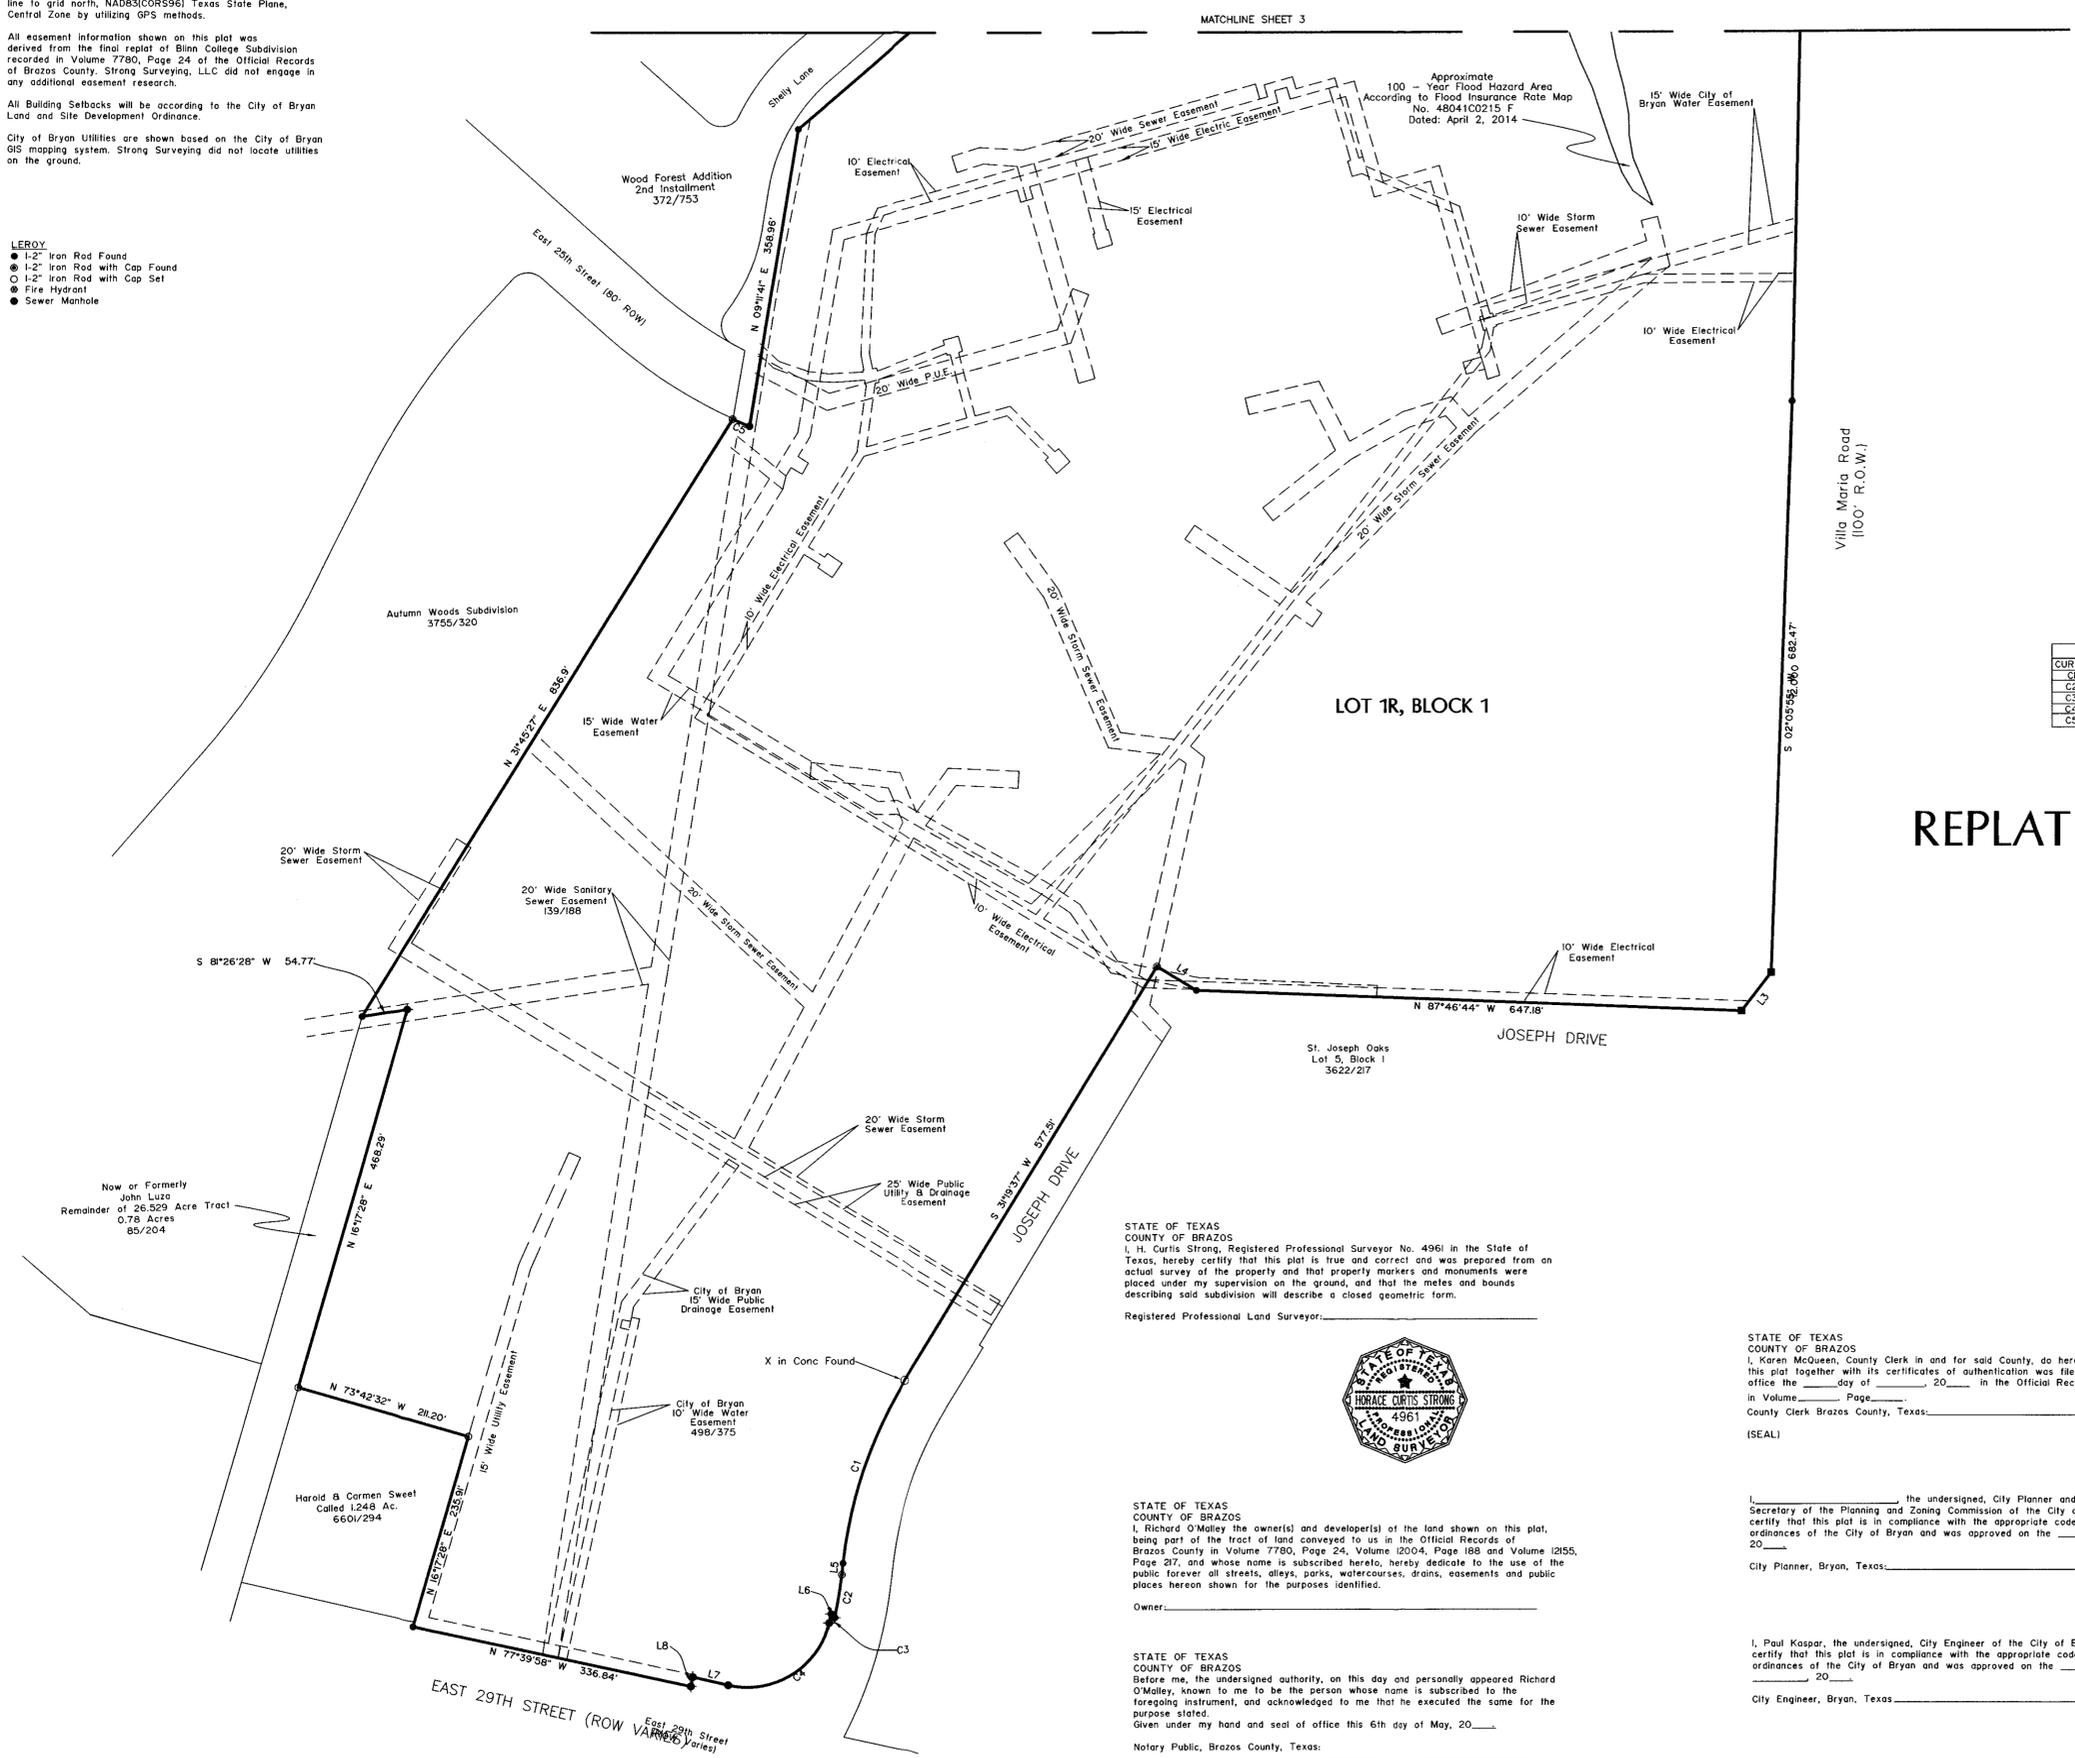

MATCHLINE SHEET 3

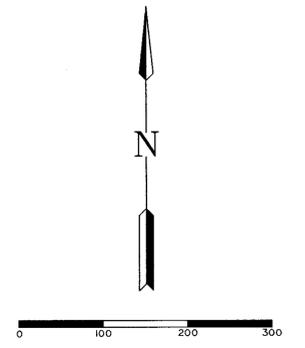

LINE	BEARING	DISTANCE
L1	S 76°15'48" W	34.28'
L2	S 42°52'59" W	61.15'
L3	S 37°18'43" W	57.50'
L4	N 58°36'38" W	54.84'
L5	S 08°19'50" W	13.67'
L6	N 42°47'11" W	6.11'
L7	N 76°53'26" W	43.10'
L8	S 11°53'20" W	11.45'

CURVE	CURVE TABLE				
	DELTA	RADIUS	LENGTH	CHORD BEARING	CHORD LENGTH
C1	24°19'47"	629.99'	231.22'	S 18°49'41" W	223.39'
C2	06°18'33"	470.01'	51.76'	S 09°29'05" W	51.73'
C3	09°34'14"	66.59'	11.2'	S 12°51'13" W	11.1'
C4	83°32'00"	99.8'	155.3'	S 58°27'57" W	140.58'
C5	02°07'21"	590.00'	21.86'	S 66°21'19" E	21.86'

LOT 1R, BLOCK 1

REPLAT

Site Address: 2423 Blinn Blvd, Bryan Texas, 77802

REPLAT OF BLINN COLLEGE SUBDIVISION LOT 1R-R, BLOCK 1 82.96 ACRES

BEING ALL OF LOT 1R, BLOCK 1
 BLINN COLLEGE SUBDIVISION
 VOLUME 11999, PAGE 231
 BEING ALL OF LOT 1, BLOCK 1
 AND

THE BLINN COLLEGE
 1.25 ACRES TRACT
 VOLUME 12155, PAGE 217

JOHN AUSTIN SURVEY, A-2
 BRYAN, BRAZOS COUNTY, TEXAS
 SCALE 1"=100' NOVEMBER 25, 2014
 SHEET 4 OF 4

STATE OF TEXAS
 COUNTY OF BRAZOS
 I, H. Curtis Strong, Registered Professional Surveyor No. 4961 in the State of Texas, hereby certify that this plat is true and correct and was prepared from an actual survey of the property and that property markers and monuments were placed under my supervision on the ground, and that the metes and bounds describing said subdivision will describe a closed geometric form.
 Registered Professional Land Surveyor: _____



STATE OF TEXAS
 COUNTY OF BRAZOS
 I, Richard O'Malley (the owner(s) and developer(s) of the land shown on this plat, being part of the tract of land conveyed to us in the Official Records of Brazos County in Volume 7780, Page 24, Volume 12004, Page 188 and Volume 12155, Page 217, and whose name is subscribed hereto, hereby dedicate to the use of the public forever all streets, alleys, parks, watercourses, drains, easements and public places hereon shown for the purposes identified.
 Owner: _____

STATE OF TEXAS
 COUNTY OF BRAZOS
 Before me, the undersigned authority, on this day and personally appeared Richard O'Malley, known to me to be the person whose name is subscribed to the foregoing instrument, and acknowledged to me that he executed the same for the purpose stated.
 Given under my hand and seal of office this 6th day of May, 20____.

Notary Public, Brazos County, Texas:
 (NOTARY SEAL)

STATE OF TEXAS
 COUNTY OF BRAZOS
 I, Karen McQueen, County Clerk in and for said County, do hereby certify that this plat together with its certificates of authentication was filed for record in my office the ____ day of ____, 20____ in the Official Records of Brazos County in Volume ____ Page ____.
 County Clerk Brazos County, Texas: _____
 (SEAL)

I, _____, the undersigned, City Planner and/or designated Secretary of the Planning and Zoning Commission of the City of Bryan, hereby certify that this plat is in compliance with the appropriate codes and ordinances of the City of Bryan and was approved on the ____ day of ____, 20____.
 City Planner, Bryan, Texas: _____

I, Paul Kaspar, the undersigned, City Engineer of the City of Bryan, hereby certify that this plat is in compliance with the appropriate codes and ordinances of the City of Bryan and was approved on the ____ day of ____, 20____.
 City Engineer, Bryan, Texas: _____

OWNER: Washington County Junior College District
 902 College Ave.
 Brenham, Texas 77833-4049
 Phone No. 979-830-4054
 Fax 979-830-4155

STRONG SURVEYING
 1722 Broadmoor, Suite 305
 Bryan, Texas 77802
 Phone: (979) 776-9836
 Fax: (979) 731-0096
 Firm No. 10093500 email: curtis@strongsurveying.com