



**LEGAL DESCRIPTION:** Sunset Subdivision, Phase 2, Block 3, Lot 6

**STRUCTURE(S):** single-family residence

**PROPERTY OWNER(S):** Tess Keaton

**LIENHOLDER(S)/  
MORTGAGEE(S):** none

**ACTIVE UTILITIES:**  yes  no **DISCONNECTED ON:** Still Current

**BRAZOS COUNTY APPRAISAL DISTRICT/TAX OFFICE INFORMATION:**

**PROPERTY ID:** 44695  
**IMPROVEMENT VALUE:** \$21,750.00 (2014)  
**YEAR BUILT:** 1950  
**SF OF LIVING AREA:** 768  
**CURRENT OWNER SINCE:** 2007  
**PROPERTY TAXES OWED:** \$1,461.84 (2012-2013)

**BACKGROUND:**

- On February 13, 2013, the Public Works Call Center received a complaint that the person living in the house at 1010 W. 17<sup>th</sup> Street has no running water, that the home was dirty, and that there was little upkeep on the property. A check on utility records showed no active utilities (water, electricity) since December 2010 at that time.
- City staff from Building Services and Fire Department made contact with the tenant and went over repairs needed and permits required (Plumbing and Electrical). No permits were ever obtained.
- In a follow-up inspection in the summer of 2014, the house appeared occupied and utilities were now on.
- In several discussions with the owner of the house, the owner has not provided plans or estimates for repairs.
- On July 28, 2014 the owner relayed to City staff that the current tenant did not have permission to live in the house and they have been unsuccessful in getting the house vacated.
- During its regular meeting on October 27, 2014, the Commission voted to issue an order to repair the structure within 90 days, and to show compliance with the repair order during the January 2015 Commission meeting.
- City staff met with the tenants on November 11, 2014 and went over repairs, permits, and inspections needed. City staff provided the tenants with the attached repair list during this time.
- During its regular meeting on February 23, 2015, the Commission voted to issue a new order to repair the structure within 90 days, and to show compliance with the repair order at each regular scheduled hearing. The following timeline was set:

7 days	get building permit
15 days	have electrical and plumbing permit pulled
60 days	all interior repairs complete
90 days	all exterior repairs complete

- A building permit was obtained on February 26, 2015.
- The electrical permit was obtained on March 6, 2015.
- During its regular meeting on March 23, 2015, the Commission voted to issue a new order to repair the structure within 60 days, and to show compliance with the repair order at each regular scheduled hearing. The following timeline was set:

5 days	plumber to obtain plumbing permit
15 days	Have plumber and electrician call for inspections after making all repairs to electrical and plumbing systems.

Have smoke detectors installed in bedrooms and area outside bedrooms.

Have carbon monoxide detector installed per code.

AFCI circuit breakers need to be added on all circuits per current electrical code due to previous work done without inspections. GFI outlets or circuits required where required by code. Electrician needs to check attic and under house for any open joints or non complaint electrical.

30 days	Call for inspection of interior for final inspection (repairs to interior siding may require other inspections prior to covering work or
---------	--

60 days	Call for final exterior inspection (repairs to exterior siding will require framing inspections, insulation inspections, moisture barrier inspection, etc. prior to new siding being installed).
---------	--

- As of March 30, 2015, a plumbing permit has been obtained.
- As of April 8, 2015, no inspections have been called in.
- On April 13, 2015, the Chief Building Official called the permit holder, Mr. Campbell, and reminded him of the timeline for repairs and advised that the city would drop off another copy of the Commission's order of March 23, 2015 a courtesy reminder.
- City staff was told by occupant of the home that the electrician and plumber had been making repairs and she would call the City for an inspection soon and before the April meeting. Ms. Fields also provided the attached letter dated April 13, 2015 which outlines some of the repairs done to date on the second page.
- Staff believes that the property is not currently in compliance with the Commission's order of March 23, 2015 due to the ownership issue and weather. Staff recommends that the Commission issue a new repair order, to allow for repairs to be completed and for this property to be rehabilitated. **Please refer to page 4 and 5 of this report.**

#### **ATTACHMENTS:**

1. staff recommendation
2. pictures
3. dangerous structures survey reports
4. 1010 W. 17<sup>th</sup> Street repair list (delivered to tenant on November 11, 2014)
5. Building Permit application and estimates submitted on February 2, 2015
6. Letter dated April 13, 2015 which outlines some of the repairs done to date on the second page.

**BUILDING AND STANDARDS COMMISSION  
STAFF RECOMMENDATION**



**April 27, 2015**

**Case #: 2049**

**Building Address: 1010 W 17<sup>th</sup> Street**

**Record Owner(s): Tess Keaton**

**The City's Chief Building Official has requested this Commission hearing to discuss the building on this property, and all legal notices of the hearing were provided to record owners, lienholders, and mortgagees. They were also notified that if they wanted to repair the building they needed to meet with City staff and come to the hearing with a detailed plan for repairs, including cost estimates. Based on the surveys, reports, photographs, and other evidence provided to the Commission, the City recommends that the Commission find the building unsafe based on the standards set forth in Bryan Code of Ordinances Section 14-224 subsection(s):**

- 1)  The building, structure, or any part thereof is likely to partially or fully collapse.
- 2)  The structure or any part thereof was constructed or maintained in violation of any provision of the City's Building Code, or any other applicable ordinance or law of the city, county, state or federal government.
- 3)  One or more walls or other vertical structural members list, lean, or buckle to such an extent that a plumb line passing through the center of gravity falls outside of the middle third or its base.
- 4)  The foundation or the vertical or horizontal supporting members are twenty five percent (25%) or more damaged or deteriorated.
- 5)  The non supporting coverings of walls, ceilings, roofs, or floors are fifty percent (50%) or more damaged or deteriorated.
- 6)  The structure has improperly distributed loads upon the structural members, or they have insufficient strength to be reasonably safe for the purpose used.
- 7)  The structure or any part thereof has been damaged by fire, water, earthquake, wind, vandalism, or other cause to such an extent that it has become dangerous to the public health, safety and welfare.
- 8)  The structure or any part thereof has inadequate means of egress as required by the City's Building Code.
- 9)  The structure does not have adequate light ventilation, or sanitation facilities as required by the City's Building Codes and Plumbing Code.

**The City further recommends that the Commission find that:**

- the building is occupied and poses a hazard to health, safety, or general welfare of the occupants and/or the general public and must be vacated.**
- the building may be feasibly repaired in compliance with City ordinances.**

**The City recommends that the Commission issue an order to the owner, lienholder, or mortgagee to:**

- repair the building within 60 days, in accordance with the schedule below:**

<b><u>Deadline</u></b>	<b><u>Task</u></b>
<b>5 days</b>	<b>Have plumber obtain plumbing permit</b>
<b>15 days</b>	<b>Have plumber and electrician call for inspections after making all repairs to electrical and plumbing systems.</b>  <b>Have smoke detectors installed in bedrooms and area outside bedrooms.</b>  <b>Have carbon monoxide detector installed per code.</b>  <b>AFCI circuit breakers need to be added on all circuits per current electrical code due to previous work done without inspections. GFI outlets or circuits required where required by code. Electrician needs to check attic and under house for any open joints or non complaint electrical.</b>
<b>30 days</b>	<b>Call for inspection of interior for final inspection (repairs to interior siding may require other inspections prior to covering work or</b>
<b>60 days</b>	<b>Call for final exterior inspection (repairs to exterior siding will require framing inspections, insulation inspections, moisture barrier inspection, etc. prior to new siding being installed).</b>

- appear before the Commission during the regularly scheduled meeting in June 2015 to demonstrate full compliance with the time schedule.**

**The City recommends that the Commission orders that the City may:**

- disconnect water and electric utilities to the building; and**
- secure the structure, demolish the building and remove the debris in accordance with Chapter 14 of the City of Bryan's Code of Ordinances if the owner, lienholder, or mortgagee fails to comply with the Commission's order.**

PICTURES: 09-04-14



Front Porch



Siding and foundation issues



Holes in siding, wall line not plumb



Roof damage, lower siding deteriorating



Repairs done without permits and work covered



Repairs done without permits and work covered



Work covered, no permits, concern about electrical work that has been done and covered without city inspections.



Plumbing / electrical work done without permits and inspections.



Missing plug cover.



Missing light fixtures.



Extension cords




Ceilings being repaired without permits and inspections.



Ceilings being repaired without permits and inspections.

Open plumbing vent pipe.

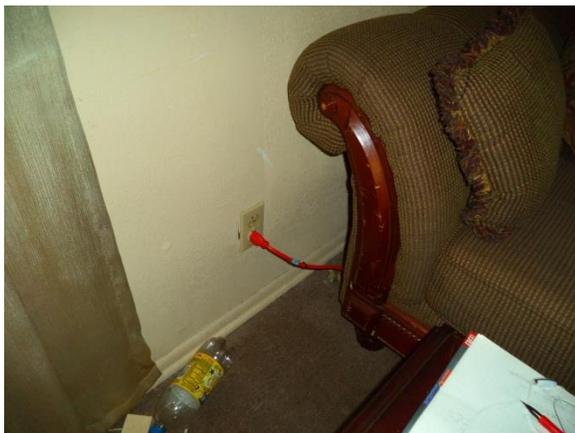

Extensive use of extension cords.

## **1010 W 17<sup>th</sup> Repair list (Delivered to tenant on November 11, 2014)**

Commissioners ordered the structure to be repaired in 90 days.

Required:

- Building Permit
- Electrical permit by licensed electrician
- Plumbing permit by licensed plumber
- HVAC permit by licensed Mechanical contractor
- Abide by all city inspection procedures and policies, call for inspections prior to covering work, obtain Certificate of Occupancy before release of power
- All electrical to meet 2011 National Electrical Code requirements and City of Bryan Amendments
- Repair/replace damaged wall framing, exterior sheathing, etc.
- Repair siding /replace missing asbestos boards/ paint house – check for rotten walls at lower half of each side
- Add wall insulation R13 where exposed wall cavities
- Add ceiling insulation R30
- Replace damaged windows with double pain low E windows - .35 maximum SHGC, .65 maximum U-factor, bedroom windows need to meet requirements for
- Repair all damaged interior finishes – after inspections
- Repair / replace all damaged light fixtures
- Install new roof or repair existing roof where damaged
- Code required landings / steps/ guards / and handrails at exterior doors – back door, front door, etc.
- Make sure approved crawl space skirting, ventilation, and access

**Please call or email if any questions. City staff is available to meet on site and go over all repairs needed in order to obtain a certificate of occupancy.**

**Gregory S. Cox, CBO**

Chief Building Official

Development Services, City of Bryan

[www.bryantx.gov](http://www.bryantx.gov)

[gcox@bryantx.gov](mailto:gcox@bryantx.gov)

979-209-5031 office

979-209-5035 fax

**CITY OF BRYAN APPLICATION FOR BUILDING PERMIT**  
 P.O. Box 1000 Bryan Texas 77805 \* Phone: 979-209-5010 \* Fax: 979-209-5035 \* www.bryantx.gov

*Per BSC*

<b>1. ADDRESS / LOCATION OF WORK:</b> ADDRESS: 1010 West 17 <sup>th</sup> Street SUBDIVISION: Sunset #2 PHASE: 2      LOT: 6      BLOCK: 3		<b>2.</b> DATE OF APPLICATION: 2/2/2015 PERMIT # (by city): 15-259 WTR / SWR # (by city): PROPERTY R-NUMBER: R44695	
<b>3. PROPERTY OWNER INFORMATION</b> NAME: Willie D. Campbell & Wilma J. Fields ADDRESS: 2712 Hwy 21 P.O. Box 6275 CITY/STATE/ZIP: Bryan, Tx 77805 EMAIL: N/A PHONE: (979)204-8295 / 436-5072		<b>4. GENERAL CONTRACTOR INFORMATION</b> NAME: ADDRESS: N/A CITY/STATE/ZIP: EMAIL: PHONE:	
5. ELECTRICIAN (Name & Phone #): N/A		6. PLUMBER (Name & Phone #): N/A	
8. ARCHITECT - If required by state or city ordinance (Name & Phone #): N/A		7. HVAC (Name & Phone #): N/A	
9. ENGINEER - If required by state or city ordinance (Name and Phone #): N/A			
10. CLASS OF WORK (Check the appropriate box): <span style="float:right">Call before you dig! (1-800-344-8377) Free service!</span> Commercial: <input type="checkbox"/> Residential: <input checked="" type="checkbox"/> Remodel: <input type="checkbox"/> Addition: <input type="checkbox"/> Repair: <input checked="" type="checkbox"/> New Construction: <input type="checkbox"/> Demolition: <input type="checkbox"/>			
11. DESCRIPTION OF WORK: Mostly cosmetics consisting of replacing two glass windows, install insulation in attic, 6 siding trim, hardi planks, & painting change out (1) electrical outlet.		Present Use: home to indigent daughter Intended Use: same Constructing Driveway in R.O.W.? N/A    Constructing Sidewalk in R.O.W.? N/A	
12. Square feet of heated area: 768 Square feet of unheated area: 72 Square feet total: 840	13. # of Buildings: 1 14. Foundation Type: Pier & beam 15. Number of floors: 1	16. # of Dwelling Units: 1 # of bedrooms: 2 17. Irrigation Tap Size: N/A 18. Fire Line Tap Size: N/A	19. Water Tap Size: N/A 20. Sewer Tap Size: N/A 21. Official Use Only-Misc. Fees: Long Tap Fee: D. & T. Fee: Work w/o Permit fee:
 CITY OF BRYAN <i>The Good Life. Every Day.</i>		<b>22. Estimated Valuation</b> (Cost of Labor and Materials for project): \$ 2,500.00 <b>23. Total Permit Fee</b> (Valuation + Tap Fees + Any Misc. Fees): \$ 40.00	

Please continue to back side of application for additional items.  
 Applicant's signature required on back of application for permit approval.

REVISED 8/2013

# CITY OF BRYAN APPLICATION FOR BUILDING PERMIT

P.O. Box 1000 Bryan Texas 77805 \* Phone: 979-209-5010 \* Fax: 979-209-5035 \* www.bryantx.gov

**Note:** Please initial in the box adjacent to each statement to affirm that you have read, understand, and each of these requirements. **Applicant to sign bottom of this page.**

### COMMERCIAL PERMIT CHECKLIST:

- TEXAS ACCESSIBILITY STANDARD (TAS) PROJECT REGISTRATION# EABPRJ \_\_\_\_\_  
(For Commercial/Public projects with a cost of \$50,000 or more)
- Existing Commercial/Public buildings: Attach copy of Asbestos Survey. TDH Inspector's Name and License No.: \_\_\_\_\_
- I have complied with the City of Bryan Ordinances and State Law for Architect and Engineer requirements.
- I have complied with the Texas Engineering Practice Act which requires (but not limited to) the following: an engineer's seal for heights over two stories, square footage in excess of 5,000 square feet of foundation, spans longer than 24 feet, and state requirements for engineered structural, mechanical, electrical, and plumbing systems.
- I understand that new commercial and some existing commercial site plans require separate review by City of Bryan Site Development Review Committee before a building permit can be issued.
- I have attached an electronic drawing file of all construction drawings and accompanying data to this application in PDF format, which is Adobe PDF format. Please submit all the pages within one PDF file.
- I have attached two (2) complete sets of required scaled and dimensioned plans and accompanying data (requirements listed below) to this permit application. (Requirements are for new and existing buildings – please include existing floor plans) for additions and renovations.
- I have read and have attached to this permit application all of the COMMERCIAL PLAN REQUIREMENTS listed below.
- I will comply with TCEQ (Texas Commission on Environmental Quality) requirements for storm water permits. Refer to <http://www.tceq.state.tx.us/> or call 512/239-1000.

### COMMERCIAL PLAN Requirements (2 copies + digital):

- Site Plan or Civil Plan and details
  - Foundation Plan and Details
  - Floor Plan and Details
  - Structural plans and details ( framing, etc)
  - Mechanical Plans and Details
  - Electrical Plan and Details
  - Plumbing Plan and details
  - Exterior Building Elevations, Roof Plan
  - Energy code compliance information; Rescheck, Comcheck, or compliance by default tables of Chapter 8 (Commercial) of International Energy Conservation Code. Include square footages of gross wall areas and gross glazing areas on plans. [www.energycodes.gov](http://www.energycodes.gov)
- Note: Please allow two weeks for full plan reviews and building permit issuance.

Call before you dig! (1-800-344-8377) Free Service!

### RESIDENTIAL PERMIT CHECKLIST:

- Residential site plan requires submission of City of Bryan Residential Site Plan Application. Residential Site Plan shall be 8 1/2"X11" format. Locate and dimension driveways, building setbacks, property lines, label overall dimensions of all structures on the site.
- I have read and have attached to this permit application all of the RESIDENTIAL PLAN REQUIREMENTS listed below.
- I will comply with TCEQ (Texas Commission on Environmental Quality) requirements for storm water permits. This includes submitting NOI per SWP3. Refer to <http://www.tceq.state.tx.us/> or CALL 512/239-1000.

### RESIDENTIAL PLAN Requirements (2 copies):

- Site Plan
- Foundation Plan and Details
- Floor Plan and Details
- Structural plans and details ( framing, etc)
- Narrow wall bracing and exterior sheathing notes
- Mechanical (HVAC) location of units noted
- Electrical switch and outlet plan
- Plumbing fixture locations noted
- Exterior Building Elevations, Roof Plan
- Energy code compliance information; Rescheck, Comcheck, or compliance by default tables of Chapter 5 (Residential) of International Energy Conservation Code. Include square footages of gross wall areas and gross glazing areas on plans. [www.energycodes.gov](http://www.energycodes.gov)
- Copy of NOI (Notice of Intent) for new home construction

### All Applicants – Please Read:

1. The Permit issued for this application becomes null and void if work or construction authorized is not commenced within six months, or if construction work is suspended or abandoned for a period of one year at any time after work is commenced.
2. Revised construction plans to be submitted for city review and approval is required for any changes made after City of Bryan building permit issuance.
3. The Permittee or Applicant is responsible for compliance with Deed and/or HOA restrictions.

Applicant Printed Name: Willie Campbell Applicant Signature: [Signature] Date: 2-2-15

Official Use: (do not issue permit unless signed by plans examiner) Plans Examiner Signature: \_\_\_\_\_ Plan Review Attached: Yes No  
 Development Coordinator approval: \_\_\_\_\_ Plan Review Comments in H.T.E.: Yes No  
 Approved Date: \_\_\_\_\_

**THANK YOU!**  
Revised 8/2013

Submittal of the above information with a fully completed application is required to approve/issue the Permit in a timely manner. Omission of any information will cause the review to be delayed until the information is received.

Repair Work/Parts/Supplies/Labor  
1010 West 17<sup>th</sup> Street  
Bryan, Texas 77803

<u>Material</u>	<u>Cost</u>	<u>Qty</u>	<u>Total</u>
Insulation	37.00/bag	(4)	160.00
Hardi Plank	6.00/board	(40)	240.00
Window Glass	50.00/glass	(2)	100.00
Tyrek/lours	70.00/roll	(1)	70.00
2X6X8 Treated	7.00/board	(6)	60.00
Siding Trim	9.00/bd	(6)	60.00
5 Gallons Paint	50.00	(1)	50.00
Plumbing & Electrical Inspections only			1600.00
Labor (to be performed by Senior Carpenter)			.00
Miscellaneous Items			<u>110.00</u>
			2500.00

Submitted by: Willie D. Campbell  
Senior Carpenter  
February 2, 2015



# Dangerous Structures Survey Report

Chief Building Official

Case #2049

A. PROPERTY ADDRESS: 1010 W. 17<sup>th</sup> Street, Sunset PH 2, Block 3, Lot 6 768 S.F. \$21,750

B. SPECIFICATIONS: No. Rooms S+/- No. Stories 1 No. Structures 1

STRUCTURAL USE

CONSTRUCTION

OCCUPANCY

- Residential/Single Family
- Mixed Use
- Commercial
- Residential/Multi Family
- Accessory Structure(s)

- Box
- Frame 1950
- Masonry
- Mobile Home

- Occupied
- Vacant
- Open

C. FINDINGS

01. The structure or a part thereof was constructed or maintained in violation of a provision of the City's building code, other applicable ordinance, state law, or federal law. Specifically, the following:

2009 IRC - 2011 NEC

Main structure?  Accessory structure?

02. Any wall or other vertical structural members list, lean, or buckle to an extent that a plumbline passing through the center of gravity falls outside of the middle third of its base. Main structure?  Accessory structure?

03. The foundation or the vertical or horizontal supporting members are materially damaged or deteriorated. Main structure?  Accessory structure?

04. The non-supporting coverings of walls, ceilings, roofs, or floors are materially damaged or deteriorated. Main structure?  Accessory structure?

05. The structure has improperly distributed loads upon the structural members, or they have insufficient strength to be reasonably safe for the purpose used. Main structure?  Accessory structure?

06. The structure or any part thereof has inadequate means of egress as required by the city's building code. Main structure?  Accessory structure?

07. The structure is unsanitary, unfit for human habitation, or likely to cause sickness due to damage, deterioration, or inadequate design/construction. Specifically the structure does not meet the city's requirements for:

- light
- ventilation
- sanitation facilities

Main structure?  Accessory structure?

\_\_\_ 08. Injury to persons or damage to property will result because portion, member or appurtenance is likely to fail, become detached or dislodged, or collapse.  
Main structure? \_\_\_ Accessory structure? \_\_\_

\_\_\_ 09. Unable to give reasonable protection to any occupants from weather elements or danger of collapse because of:  
\_\_\_ Holes or cracks in the floor, exterior wall or roof  
\_\_\_ Loose, rotten, warped or protruding boards  
Main structure? \_\_\_ Accessory structure? \_\_\_

X 10. Is manifestly unsafe for the purpose for which it is being used or so as not to give reasonable protection from danger of collapse or fire because of:  
X Defective materials  
\_\_\_ Structural deterioration  
X Interior walls or ceilings with holes, cracks or loose plaster  
Main structure? X Accessory structure? \_\_\_

\_\_\_ 11. The building, structure, or a part thereof, is unsecured and open.  
Main structure? \_\_\_ Accessory structure? \_\_\_

COMMENTS (1) DAMAGED SIDING - LOOSE SIDING OR MISSING SIDING

(2) MISSING LIGHT FIXTURES - OPEN ELECTRICAL BOXES

(3) ELECTRICAL WORK WITHOUT PERMITS (4) PLUMBING WORK

WITHOUT PERMITS (5) SHEET ROCK REPAIRS - SOME OPEN

FRAMING (6) MISSING COVERS AT OUTLETS & SWITCHES


(7) NO SKIRTING (8) OPEN SEWER PIPES? (9) EXTENSION

CORPS (10) NO ATTIC INSULATION (11) NEED TO CHECK

WALL FRAMING AT NORTH & SOUTH WALLS - WALLS OUT

OF PLUMB.

D. FLOOR PLAN (if necessary)

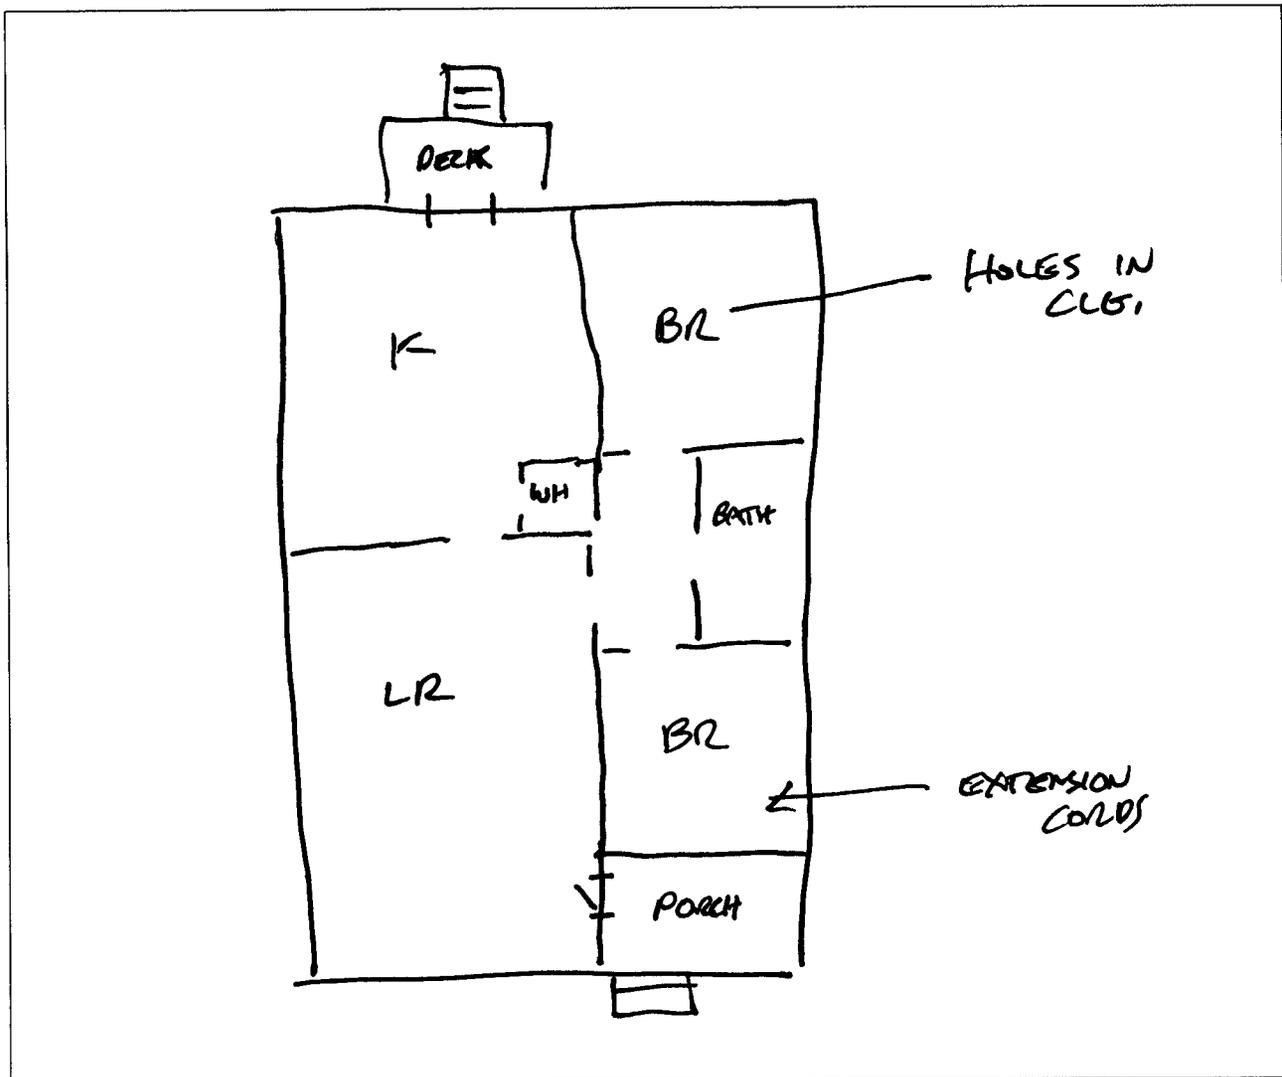

E. DETERMINATION

1. It has been determined upon inspection and investigation that the structure is dangerous, unsafe, or a hazard to public health and must be secured and:
- A.  Be vacated OR \_\_\_ remain unoccupied; and
  - B.  Be repaired OR  be demolished.
- \_\_\_ 2. It has been determined upon inspection and investigation that the structure is not dangerous, unsafe, or a hazard to public health as defined by the City's Code of Ordinances.

*Gregory S. Cox*  
Signature

GREGORY S. COX  
Printed Name

9-12-14  
Date



# Dangerous Structures Survey Report

Fire Marshal

Case #2049

A. PROPERTY ADDRESS: 1010 W. 17<sup>th</sup> Street, Sunset PH 2, Block 3, Lot 6

B. SPECIFICATIONS: No. Rooms \_\_\_\_\_ No. Stories 1 No. Structures 1

STRUCTURAL USE

CONSTRUCTION

OCCUPANCY

- Residential/Single Family  
 Mixed Use  
 Commercial  
 Residential/Multi Family  
 Accessory Structure

- Box  
 Frame  
 Masonry  
 Mobile Home

- Occupied  
 Vacant  
 Open

C. FINDINGS

- \_\_\_ 01. The structure or a part thereof has been damaged by fire, water, earthquake, wind, vandalism, or other cause to such an extent that it has become dangerous to the public health, safety, and welfare.  
I estimate that \_\_\_% of the main structure is considered a loss.  
I estimate that \_\_\_% of the accessory structure is considered a loss.
- \_\_\_ 02. The structure or a part thereof has deteriorated to such an extent that it has become dangerous to the public health, safety, and welfare.  
Main Structure? \_\_\_ Accessory Structure? \_\_\_
- \_\_\_ 03. The structure or a part thereof does not have adequate means of egress as required by the City's building code, and poses a danger in case of fire or panic.  
Main Structure? \_\_\_ Accessory Structure? \_\_\_
04. The structure or a part thereof lacks necessary fire-resistive construction, and the threat of a fire in the structure poses a risk to inhabitants, neighboring structures, and fire department personnel.  
Main Structure?  Accessory Structure? \_\_\_
05. Obsolete, damaged, or deteriorated electric wiring, gas connections, heating apparatus, or other mechanical infrastructure present a risk of fire.  
Main Structure?  Accessory Structure? \_\_\_
06. The proximity of the structure or a part thereof to other structures on this or neighboring properties constitutes a fire hazard for the other structures.  
Main Structure?  Accessory Structure? \_\_\_
07. The structure or a part thereof is in violation of the City's fire code.  
Main Structure?  Accessory Structure? \_\_\_

08. The building, structure, or a part thereof is being used by criminals, vagrants, or squatters for the purpose of suspected illegal activity.  
Main Structure?  Accessory Structure?
09. The building, structure, or a part thereof presents an attractive nuisance to children.  
Main Structure?  Accessory Structure?

COMMENTS Open wires

Leaking Sink

unpermitted wiring + construction

Previous inspection of this structure showed it to be vacant, no power, holes in floors and walls  
The repairs have been accomplished without permit or inspection

My recommendation is open walls to reveal repairs, permit and bring to code - OR Demo  
NOT SURE IT CAN BE BROUGHT TO CODE FOR ITS VALUE

D. DETERMINATION

1. It has been determined upon inspection and investigation that the structure is dangerous, unsafe, or a hazard to public health and must be secured and:
- A.  Be vacated OR  remain unoccupied; and
- B.  Be repaired OR  be demolished.
2. It has been determined upon inspection and investigation that the structure is not dangerous, unsafe, or a hazard to public health as defined by the City's Code of Ordinances.



Signature

FRED TAYLOR / DFM

Printed Name/Title

9-5-14

Date

April 13, 2015

Greg Cox  
Chief Building Official  
Building Division Planning and Development Services  
City of Bryan  
P. O. Box 1000  
Bryan, Texas 77805

Dear Mr. Cox,

I am hand delivering this correspondence to you pertaining to Daddy's House located at 1010 West 17<sup>th</sup> Street, though not at all surprised I am a little dumbfounded and taken aback of more successive actions that take place each time following an attendance of a Buildings Standards Commission Meeting to hinder the progress we are making, and before I began writing this letter to you I was on the phone with my daughter because the Police as at her house again this morning.

My condolence to Daryl Massey for the passing of his father.

Though this may be no surprise to you, on Wednesday, April 8, 2015 a group of City of Bryan Police Officers gathered at a neighborhood convenience store according to quite a few members of the community; after some time these same officers proceeded to travel in the 1000 block of West 17<sup>th</sup> Street and knocked on my daughters door at 1010 West 17<sup>th</sup> Street stating they were conducting a welfare check on her neighbor next door at 1008 West 17<sup>th</sup> Street, but she wasn't at home & asked my daughter if she knew her whereabouts (really)? The police officers pushed their way inside when my daughter answered the door, and they remained there over five hours awaiting a Search Warrant indicating they smelled marijuana inside; my daughter was not allowed to make a phone call, use the restroom or move while 3 or more officers hovered over her in an intimidating, harassing, and bullying stance. My daughters civil rights were intensely violated; the neighbor next door had arrived back home and she watched the entire situation take place, but the officers did not approach her & instead kept their focus on my daughter, which indicates this was a smoke screen from the beginning to harass Londie. My shift at work ended at 6:00 pm that day, I arrived at my daughters house approximately 15 minutes later. The Search Warrant arrived with a signature from a Judge in College Station with a time it was signed at 6:20 pm; I was not allowed to enter the house to speak to my daughter.

The NAACP President Ann Boney verbally stated that she was just passing through.; she pretended like she was there to assist in any capacity that she could, when I verified who I was by name when she inquired to who I was - her immediate statement was "if I had known who you were Wilma Fields when I stopped then I never would have stopped in the first place, because I remember the issue I had with you a couple of years ago with your

grand daughter at school". God Bless Ann Boney with the demons she is struggling with trying to be on both sides of the same issue at the same time, especially since it appeared by her statement that particular incident was still so fresh on her mind, and I had Prayed about it and given it to the GOD I worship long time ago because Ann Boney had showed me back then where her support lies; NAACP stands for the National Association for the "Advancement" of Colored People, her statement was anything BUT that.

To inform you of the progress we have made with Daddy's House - even with all the intrusions that have taken place are; a \$11.00 part for the toilet is still needed, brand new Pix flexible plumbing was completely replaced after 2012, the Smoke & CO Detectors plus the voluntary purchase of a new Kitchen sink with worn seals are the last thing that are needed for the house at the conclusion of this time frame; installation of ceiling insulation, outside paint and replacement of damaged boards for the cosmetic effects outside will follow in the last 30 days.

I hope this answers any lingering questions that you may have concerning Daddy's House. My question to you and the City Manager Joey Dunn is.....will Tess Keaton whose name is listed as the home owner on our house - actually attend the next meeting this time scheduled for 4/27/2015 at 5:30, because she hasn't shown up for any of them, allowing the City to do her bidding for her.

Please feel free to contact me with any questions or concerns you may have pertaining to Daddy's House. It appears you prefer to communicate with my twin brother Willie instead, and have him to relay any messages.

Thank you for your time.

Sincerely,

A handwritten signature in cursive script that reads "Wilma J. Fields". The signature is written in dark ink and is positioned below the word "Sincerely,".

Wilma J. Fields  
(979) 204-8295